Seller: Nicholas Christie

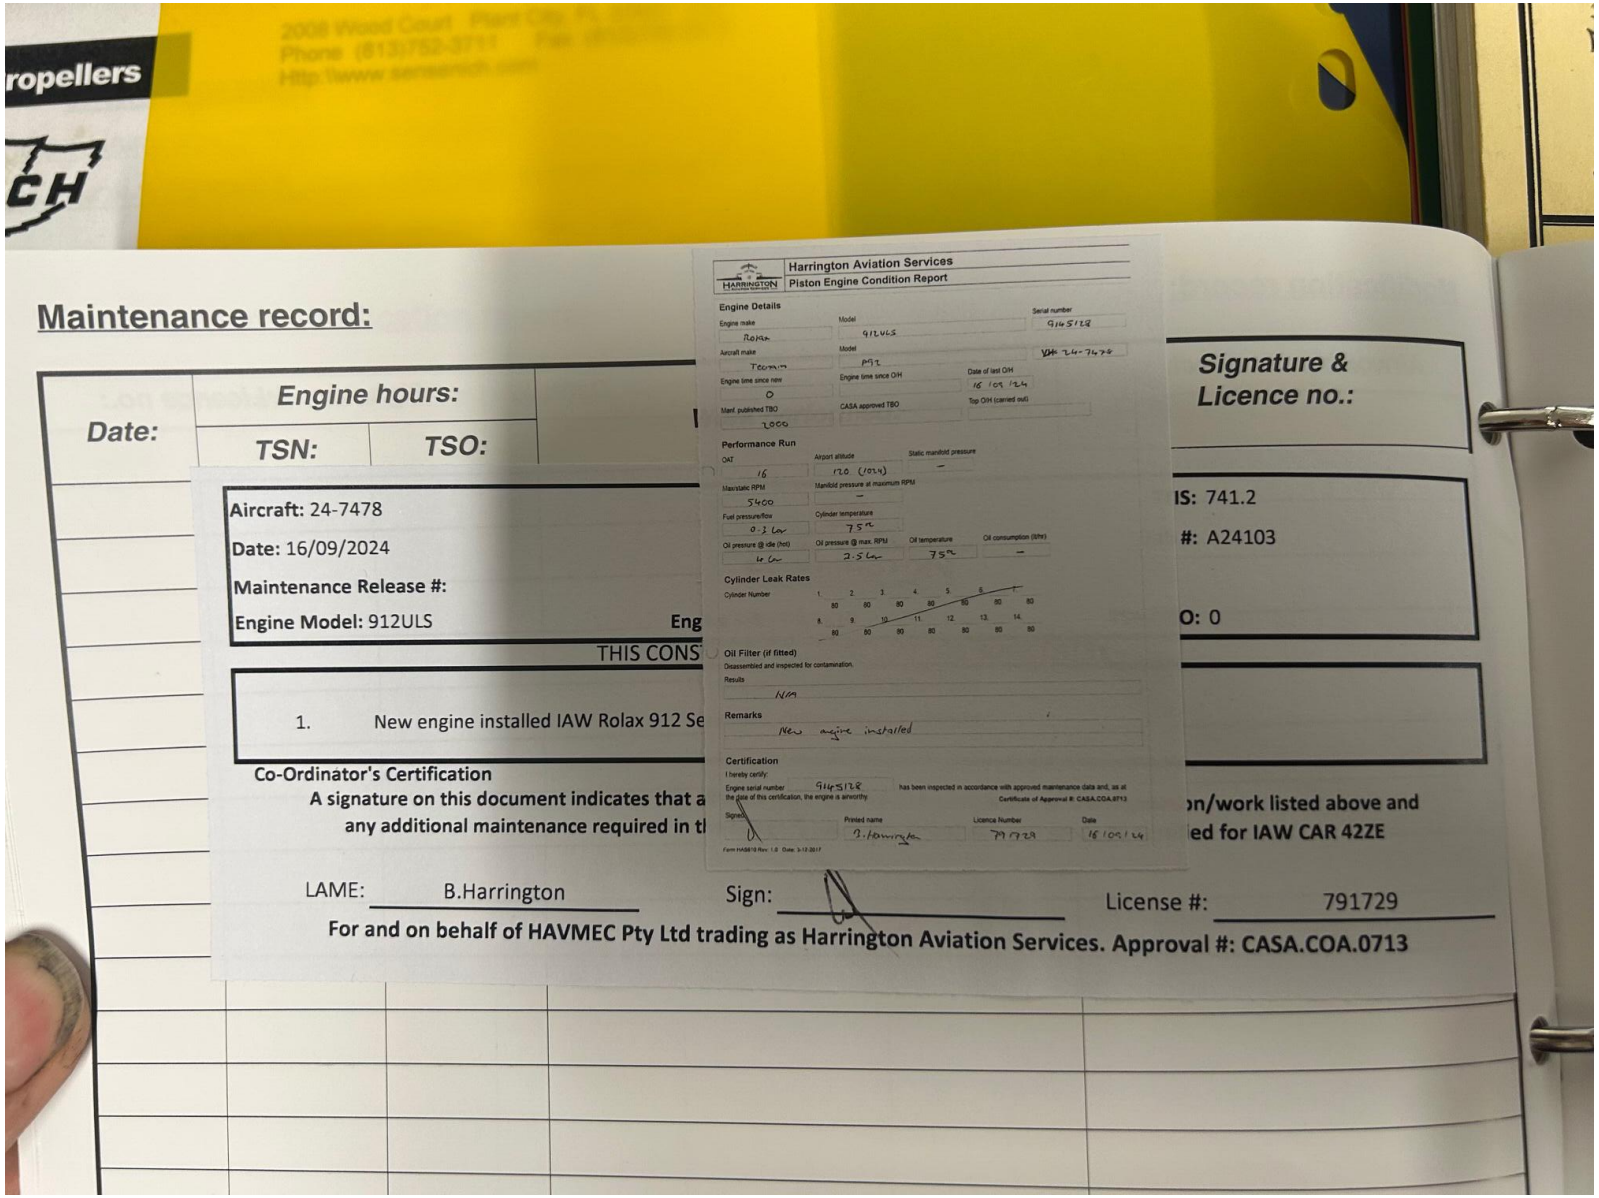

ropellers

CH

Maintenance record:

Date:	Engine hours: TSN:	TSO:	Signature & Licence no.:

Aircraft: 24-7478

Date: 16/09/2024

Maintenance Release #:

Engine Model: 912ULS Eng

THIS CONS

1. New engine installed IAW Rolax 912 Se

Co-Ordinator's Certification

A signature on this document indicates that a
any additional maintenance required in t

IS: 741.2

#: A24103

O: 0

on/work listed above and
ed for IAW CAR 42ZE

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

Harrington Aviation Services
Piston Engine Condition Report

Engine Details

Engine make: Rotax
Model: 912ULS
Serial number: 9145128
Aircraft make: Tecnam
Model: P92
VH- 24-7478
Engine time since new: 0
Engine time since O/H
Date of last O/H: 16/09/24
Manf. published TBO: 2000
CASA approved TBO
Top O/H (carried out)

Performance Run

OAT: 16
Airport altitude: 120 (1024)
Static manifold pressure: –
Max/static RPM: 5400
Manifold pressure at maximum RPM: –
Fuel pressure/flow: 0.3 bar
Cylinder temperature: 75°c
Oil pressure @ idle (hot): 4 bar
Oil pressure @ max. RPM: 2.5 bar
Oil temperature: 75°c
Oil consumption (l/hr): –

Cylinder Leak Rates

Cylinder Number: 1 80, 2 80, 3 80, 4 80, 5 80, 6 80, 7 80, 8 80, 9 80, 10 80, 11 80, 12 80, 13 80, 14 80

Oil Filter (if fitted)

Disassembled and inspected for contamination.
Results: N/A

Remarks

New engine installed

Certification

I hereby certify:
Engine serial number 9145128 has been inspected in accordance with approved maintenance data and, as at the date of this certification, the engine is airworthy
Certificate of Approval #: CASA.COA.0713
Signed: D
Printed name: B. Harrington
Licence Number: 791729
Date: 16/09/24
Form HAS610 Rev: 1.0 Date: 1-12-2017

LIGHT AIRCRAFT SALES

Go to listing: /listings/17756

Seller: Nicholas Christie

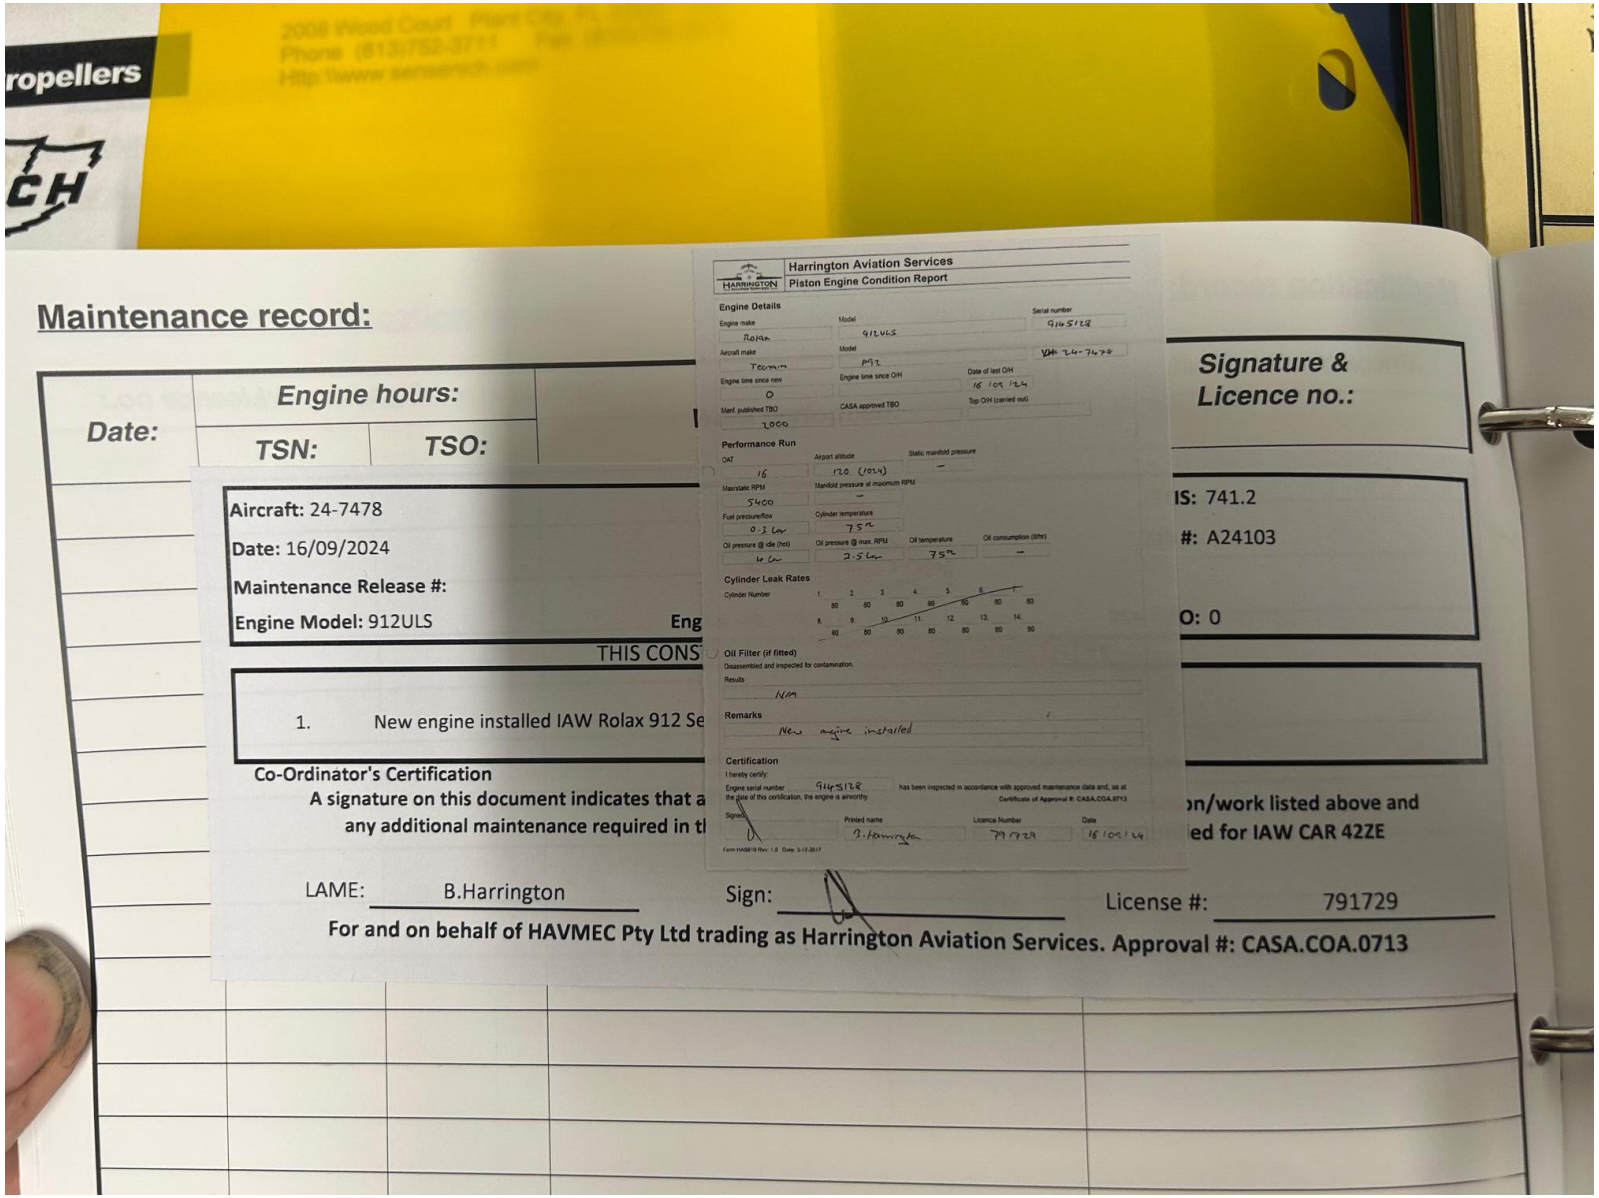

ropellers

CH

Maintenance record:

Date:	Engine hours: TSN:	TSO:	Signature & Licence no.:

Aircraft: 24-7478

Date: 16/09/2024

Maintenance Release #:

Engine Model: 912ULS Eng

THIS CONS

1. New engine installed IAW Rolax 912 Se

Co-Ordinator's Certification

A signature on this document indicates that a
any additional maintenance required in t

IS: 741.2

#: A24103

O: 0

on/work listed above and
ed for IAW CAR 42ZE

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

Harrington Aviation Services
Piston Engine Condition Report

Engine Details

Engine make: Rotax
Model: 912ULS
Serial number: 9145128
Aircraft make: Tecnam
Model: P92
VH- 24-7478
Engine time since new: 0
Engine time since O/H
Date of last O/H: 16/09/24
Manf. published TBO: 2000
CASA approved TBO
Top O/H (carried out)

Performance Run

OAT: 16
Airport altitude: 120 (1024)
Static manifold pressure: –
Max/static RPM: 5400
Manifold pressure at maximum RPM: –
Fuel pressure/flow: 0.3 bar
Cylinder temperature: 75°c
Oil pressure @ idle (hot): 4 bar
Oil pressure @ max. RPM: 2.5 bar
Oil temperature: 75°c
Oil consumption (l/hr): –

Cylinder Leak Rates

Cylinder Number: 1 80, 2 80, 3 80, 4 80, 5 80, 6 80, 7 80, 8 80, 9 80, 10 80, 11 80, 12 80, 13 80, 14 80

Oil Filter (if fitted)

Disassembled and inspected for contamination.
Results: N/A

Remarks

New engine installed

Certification

I hereby certify:
Engine serial number 9145128 has been inspected in accordance with approved maintenance data and, as at the date of this certification, the engine is airworthy
Certificate of Approval #: CASA.COA.0713
Signed: D
Printed name: B. Harrington
Licence Number: 791729
Date: 16/09/24
Form HAS610 Rev: 1.0 Date: 1-12-2017

LIGHT AIRCRAFT SALES

Go to listing: /listings/17756

Seller: Nicholas Christie

Log Books: Tecnam P92 Eaglet (24-7478)

MAINTENANCE RECORD

PAR

Airframe				Engine				Maints Type	Inspection and Maintenance Completed
ttis		tsm		ttis		tso			
	min	hr	min	hr	min	hr	min		

Aircraft: 24-7478
Date: 08-07-2025

HARRINGTON AVIATION SERVICES

TTIS: 779
Job #: A25119
Aircraft S/N: 1306

THIS CONSTITUTES A LOOSE LEAF LOG BOOK ENTRY

Inspections/work carried out

1. Annual inspection carried out IAW Tecnam P92 Service Manual and Rotax 912ULS Line Maintenance Manual.
2. Sensenich propeller annual inspection carried out IAW Sensenich Doc #: 2A0 - Installation Manual.
3. Rotax 100 hour inspection carried out IAW Rotax 912ULS 100 hour inspection sheets. No defects evident.
4. CAO 100.5 Appendix 1 Paragraph 3 - Pitot - Static systems inspection requirements carried out. No defects evident.
5. CAO 100.5 Appendix 1 Paragraph 4 - Testing pressure altimeters inspection requirements carried out. No defects evident.
6. CAO 100.5 Appendix 1 Paragraph 5 - Airspeed indicator inspection carried out satisfactory.
7. CAO 100.5 Appendix 1 Paragraph 6 - Fuel quantity gauges inspection carried out. No changes to current placard.
8. CAO 100.5 Appendix 1 Paragraph 14 - Periodic checking and testing of ATC transponders inspection carried out. Tested U/S. Entered onto MR.
9. NCA #55 - P92 Series flap torque tube inspection carried out. No defects evident.
10. Battery U/S. New battery installed as required.
11. CO2 detector expired. New Co2 detector installed as required.

Co-Ordinator's Certification

A signature on this document indicates that all work necessary for the completion of the inspection/work listed above and any additional maintenance required in the category has been carried out and properly certified for IAW CAR 42ZE

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

LIGHT AIRCRAFT SALES

Go to listing: /listings/17756

Seller: Nicholas Christie

Log Books: Tecnam P92 Eaglet (24-7478)

MAINTENANCE RECORD

PAR

Airframe				Engine				Maints Type	Inspection and Maintenance Completed
ttis		tsm		ttis		tso			
	min	hr	min	hr	min	hr	min		

Aircraft: 24-7478
Date: 08-07-2025

HARRINGTON AVIATION SERVICES

TTIS: 779
Job #: A25119
Aircraft S/N: 1306

THIS CONSTITUTES A LOOSE LEAF LOG BOOK ENTRY

Inspections/work carried out

1. Annual inspection carried out IAW Tecnam P92 Service Manual and Rotax 912ULS Line Maintenance Manual.
2. Sensenich propeller annual inspection carried out IAW Sensenich Doc #: 2A0 - Installation Manual.
3. Rotax 100 hour inspection carried out IAW Rotax 912ULS 100 hour inspection sheets. No defects evident.
4. CAO 100.5 Appendix 1 Paragraph 3 - Pitot - Static systems inspection requirements carried out. No defects evident.
5. CAO 100.5 Appendix 1 Paragraph 4 - Testing pressure altimeters inspection requirements carried out. No defects evident.
6. CAO 100.5 Appendix 1 Paragraph 5 - Airspeed indicator inspection carried out satisfactory.
7. CAO 100.5 Appendix 1 Paragraph 6 - Fuel quantity gauges inspection carried out. No changes to current placard.
8. CAO 100.5 Appendix 1 Paragraph 14 - Periodic checking and testing of ATC transponders inspection carried out. Tested U/S. Entered onto MR.
9. NCA #55 - P92 Series flap torque tube inspection carried out. No defects evident.
10. Battery U/S. New battery installed as required.
11. CO2 detector expired. New Co2 detector installed as required.

Co-Ordinator's Certification

A signature on this document indicates that all work necessary for the completion of the inspection/work listed above and any additional maintenance required in the category has been carried out and properly certified for IAW CAR 42ZE

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

LIGHT AIRCRAFT SALES

Go to listing: /listings/17756

Seller: Nicholas Christie

Log Books: Tecnam P92 Eaglet (24-7478)

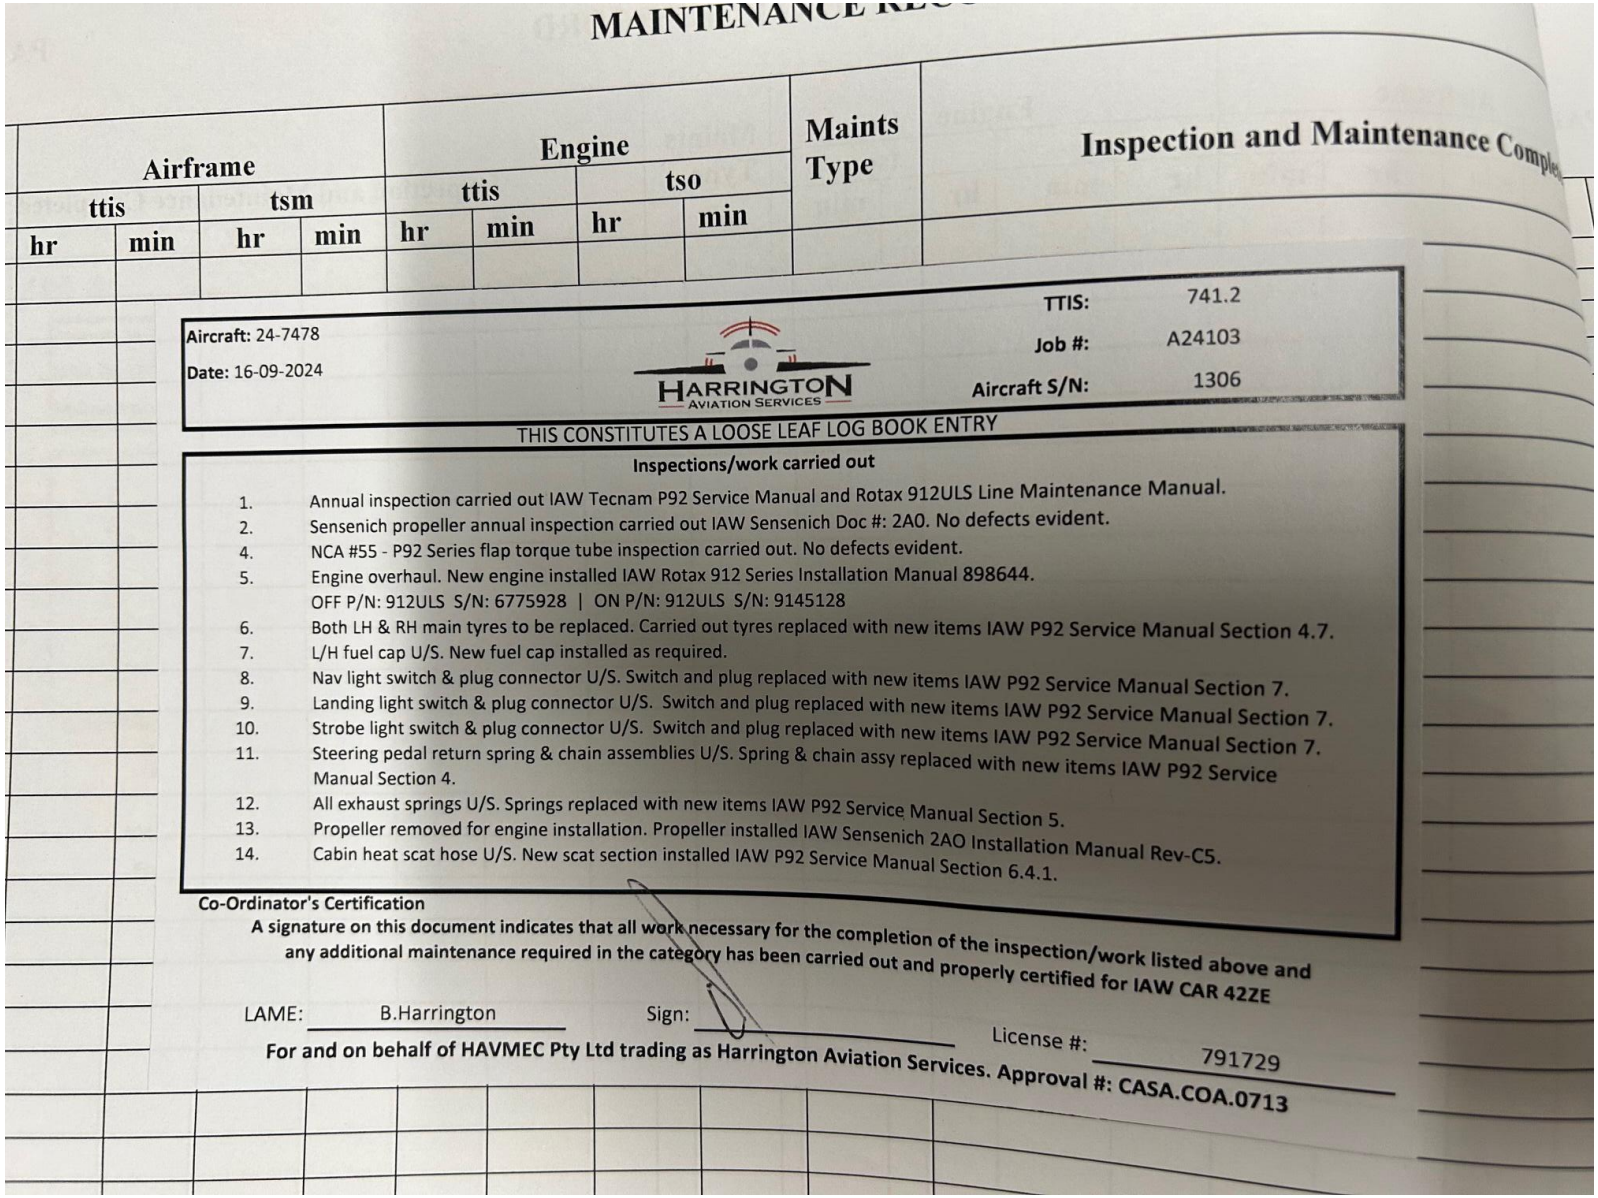

MAINTENANCE

Airframe				Engine				Maints Type	Inspection and Maintenance Comple
ttis		tsm		ttis		tso			
hr	min	hr	min	hr	min	hr	min		

Aircraft: 24-7478

Date: 16-09-2024

HARRINGTON AVIATION SERVICES

TTIS: 741.2

Job #: A24103

Aircraft S/N: 1306

THIS CONSTITUTES A LOOSE LEAF LOG BOOK ENTRY

Inspections/work carried out

1. Annual inspection carried out IAW Tecnam P92 Service Manual and Rotax 912ULS Line Maintenance Manual.
2. Sensenich propeller annual inspection carried out IAW Sensenich Doc #: 2A0. No defects evident.
4. NCA #55 - P92 Series flap torque tube inspection carried out. No defects evident.
5. Engine overhaul. New engine installed IAW Rotax 912 Series Installation Manual 898644.
   OFF P/N: 912ULS S/N: 6775928 | ON P/N: 912ULS S/N: 9145128
6. Both LH & RH main tyres to be replaced. Carried out tyres replaced with new items IAW P92 Service Manual Section 4.7.
7. L/H fuel cap U/S. New fuel cap installed as required.
8. Nav light switch & plug connector U/S. Switch and plug replaced with new items IAW P92 Service Manual Section 7.
9. Landing light switch & plug connector U/S. Switch and plug replaced with new items IAW P92 Service Manual Section 7.
10. Strobe light switch & plug connector U/S. Switch and plug replaced with new items IAW P92 Service Manual Section 7.
11. Steering pedal return spring & chain assemblies U/S. Spring & chain assy replaced with new items IAW P92 Service Manual Section 4.
12. All exhaust springs U/S. Springs replaced with new items IAW P92 Service Manual Section 5.
13. Propeller removed for engine installation. Propeller installed IAW Sensenich 2AO Installation Manual Rev-C5.
14. Cabin heat scat hose U/S. New scat section installed IAW P92 Service Manual Section 6.4.1.

Co-Ordinator's Certification

A signature on this document indicates that all work necessary for the completion of the inspection/work listed above and any additional maintenance required in the category has been carried out and properly certified for IAW CAR 42ZE

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

LIGHT AIRCRAFT SALES

Go to listing: /listings/17756

Seller: Nicholas Christie

Log Books: Tecnam P92 Eaglet (24-7478)

MAINTENANCE RECORD

Date	Airframe ttis hr	Airframe ttis min	Airframe tsm hr	Airframe tsm min	Engine ttis hr	Engine ttis min	Engine tso hr	Engine tso min	Maints Type	Inspection and Maintenance Comple

Aircraft: 24-7478

Date: 21/12/2023

Maintenance Release

HARRINGTON AVIATION SERVICES

TTIS: 726.5

Job #: A23221

Aircraft S/N: 1306

THIS CONSTITUTES A LOOSE LEAF LOG BOOK ENTRY

Inspections/work carried out

1. Annual inspection carried out IAW Tecnam P92 Service Manual and Rotax 912ULS Line Maintenance Manual.
2. Sensenich propeller annual inspection carried out IAW Sensenich Doc #: 2A0 - Installation Manual.
3. Rotax 100 hour inspection carried out IAW Rotax 912ULS 100 hour inspection sheets. No defects evident.
4. CAO 100.5 Appendix 1 Paragraph 3 - Pitot - Static systems inspection requirements carried out. No defects evident.
5. CAO 100.5 Appendix 1 Paragraph 4 - Testing pressure altimeters inspection requirements carried out. No defects evident.
6. NCA #55 - P92 Series flap torque tube inspection carried out. No defects evident.
7. LH OB brake lining found U/S. Replaced with new item IAW Tecnam Maintenance Manual Section 6-5-3.
8. CO2 detector found over due. New detector installed.

Co-Ordinator's Certification

A signature on this document indicates that all work necessary for the completion of the inspection/work listed above and any additional maintenance required in the category has been carried out and properly certified for IAW CAR 42ZE

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

LIGHT AIRCRAFT SALES

Go to listing: /listings/17756

Seller: Nicholas Christie

Log Books: Tecnam P92 Eaglet (24-7478)

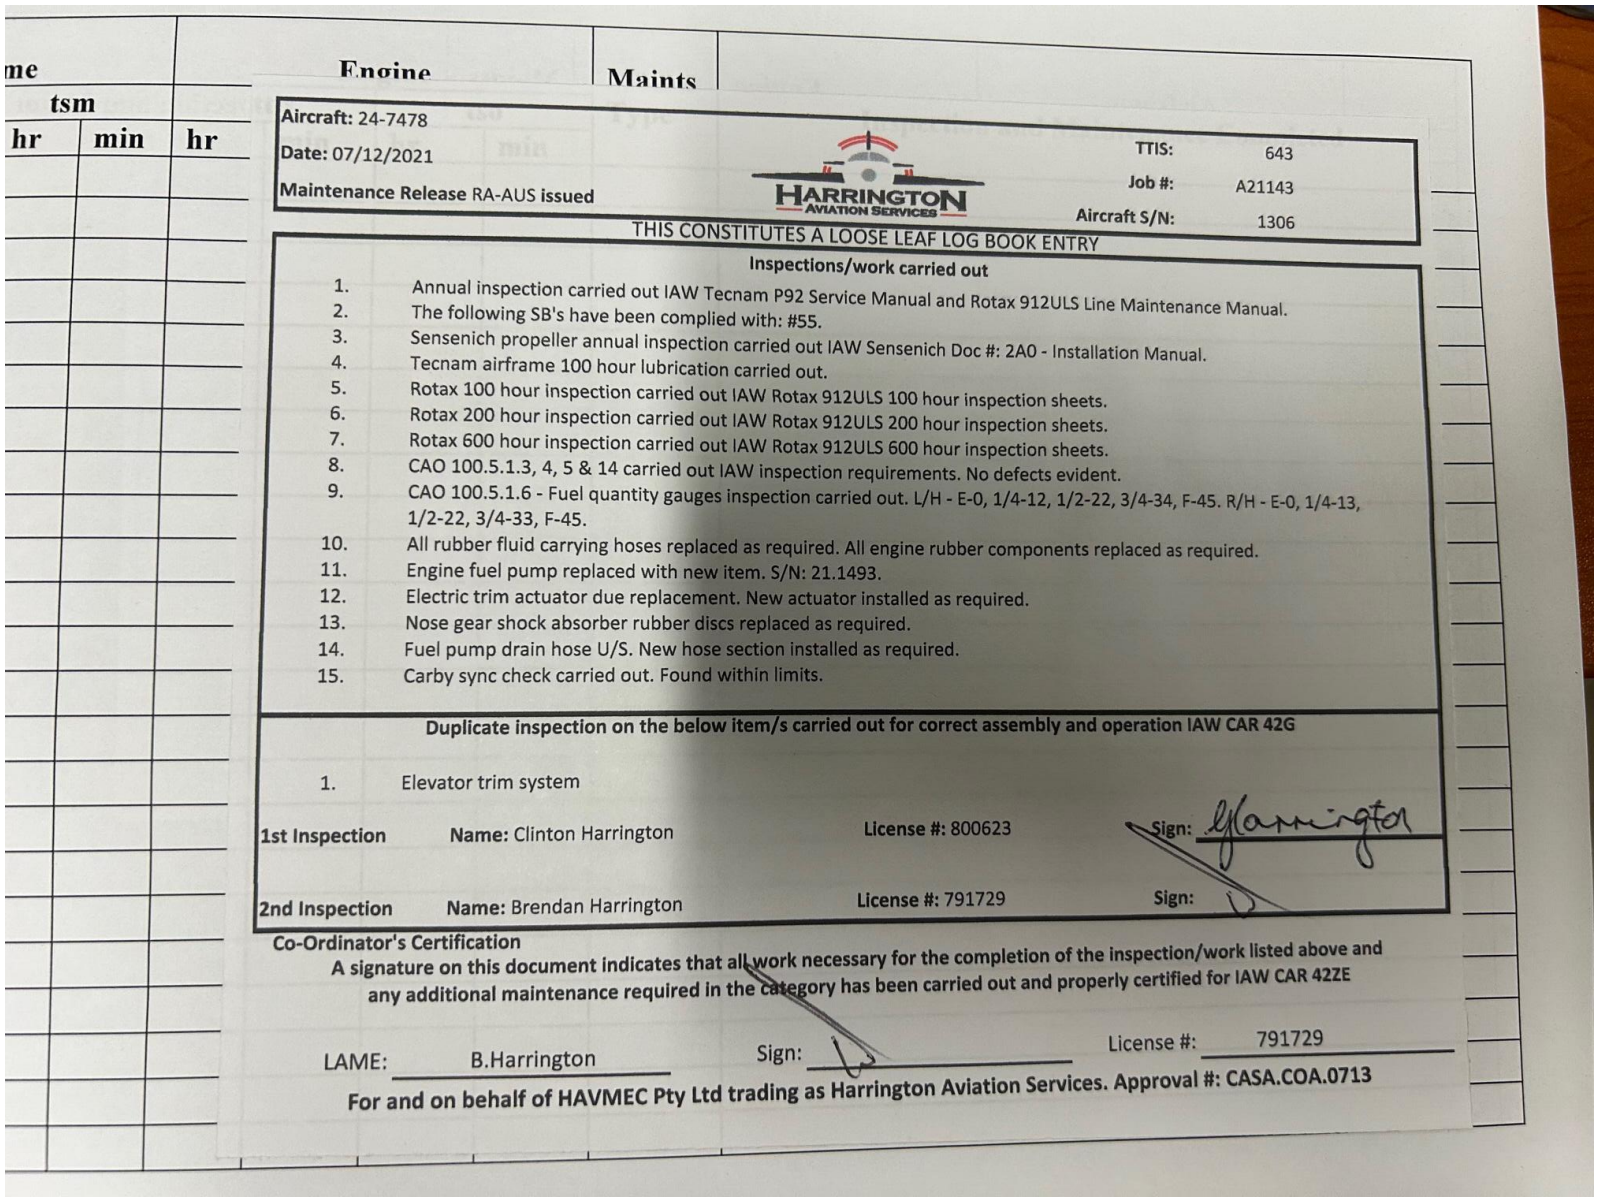

me		Engine	Maints
tsm			
hr	min	hr	

Aircraft: 24-7478
Date: 07/12/2021
Maintenance Release RA-AUS **issued**

HARRINGTON AVIATION SERVICES

TTIS: 643
Job #: A21143
Aircraft S/N: 1306

THIS CONSTITUTES A LOOSE LEAF LOG BOOK ENTRY

Inspections/work carried out

1. Annual inspection carried out IAW Tecnam P92 Service Manual and Rotax 912ULS Line Maintenance Manual.
2. The following SB's have been complied with: #55.
3. Sensenich propeller annual inspection carried out IAW Sensenich Doc #: 2A0 - Installation Manual.
4. Tecnam airframe 100 hour lubrication carried out.
5. Rotax 100 hour inspection carried out IAW Rotax 912ULS 100 hour inspection sheets.
6. Rotax 200 hour inspection carried out IAW Rotax 912ULS 200 hour inspection sheets.
7. Rotax 600 hour inspection carried out IAW Rotax 912ULS 600 hour inspection sheets.
8. CAO 100.5.1.3, 4, 5 & 14 carried out IAW inspection requirements. No defects evident.
9. CAO 100.5.1.6 - Fuel quantity gauges inspection carried out. L/H - E-0, 1/4-12, 1/2-22, 3/4-34, F-45. R/H - E-0, 1/4-13, 1/2-22, 3/4-33, F-45.
10. All rubber fluid carrying hoses replaced as required. All engine rubber components replaced as required.
11. Engine fuel pump replaced with new item. S/N: 21.1493.
12. Electric trim actuator due replacement. New actuator installed as required.
13. Nose gear shock absorber rubber discs replaced as required.
14. Fuel pump drain hose U/S. New hose section installed as required.
15. Carby sync check carried out. Found within limits.

Duplicate inspection on the below item/s carried out for correct assembly and operation IAW CAR 42G

1. Elevator trim system

1st Inspection **Name:** Clinton Harrington **License #:** 800623 **Sign:** CHarrington

2nd Inspection **Name:** Brendan Harrington **License #:** 791729 **Sign:**

Co-Ordinator's Certification

A signature on this document indicates that all work necessary for the completion of the inspection/work listed above and any additional maintenance required in the category has been carried out and properly certified for IAW CAR 42ZE

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

Go to listing: /listings/17756

LIGHT AIRCRAFT SALES

Seller: Nicholas Christie

Log Books: Tecnam P92 Eaglet (24-7478)

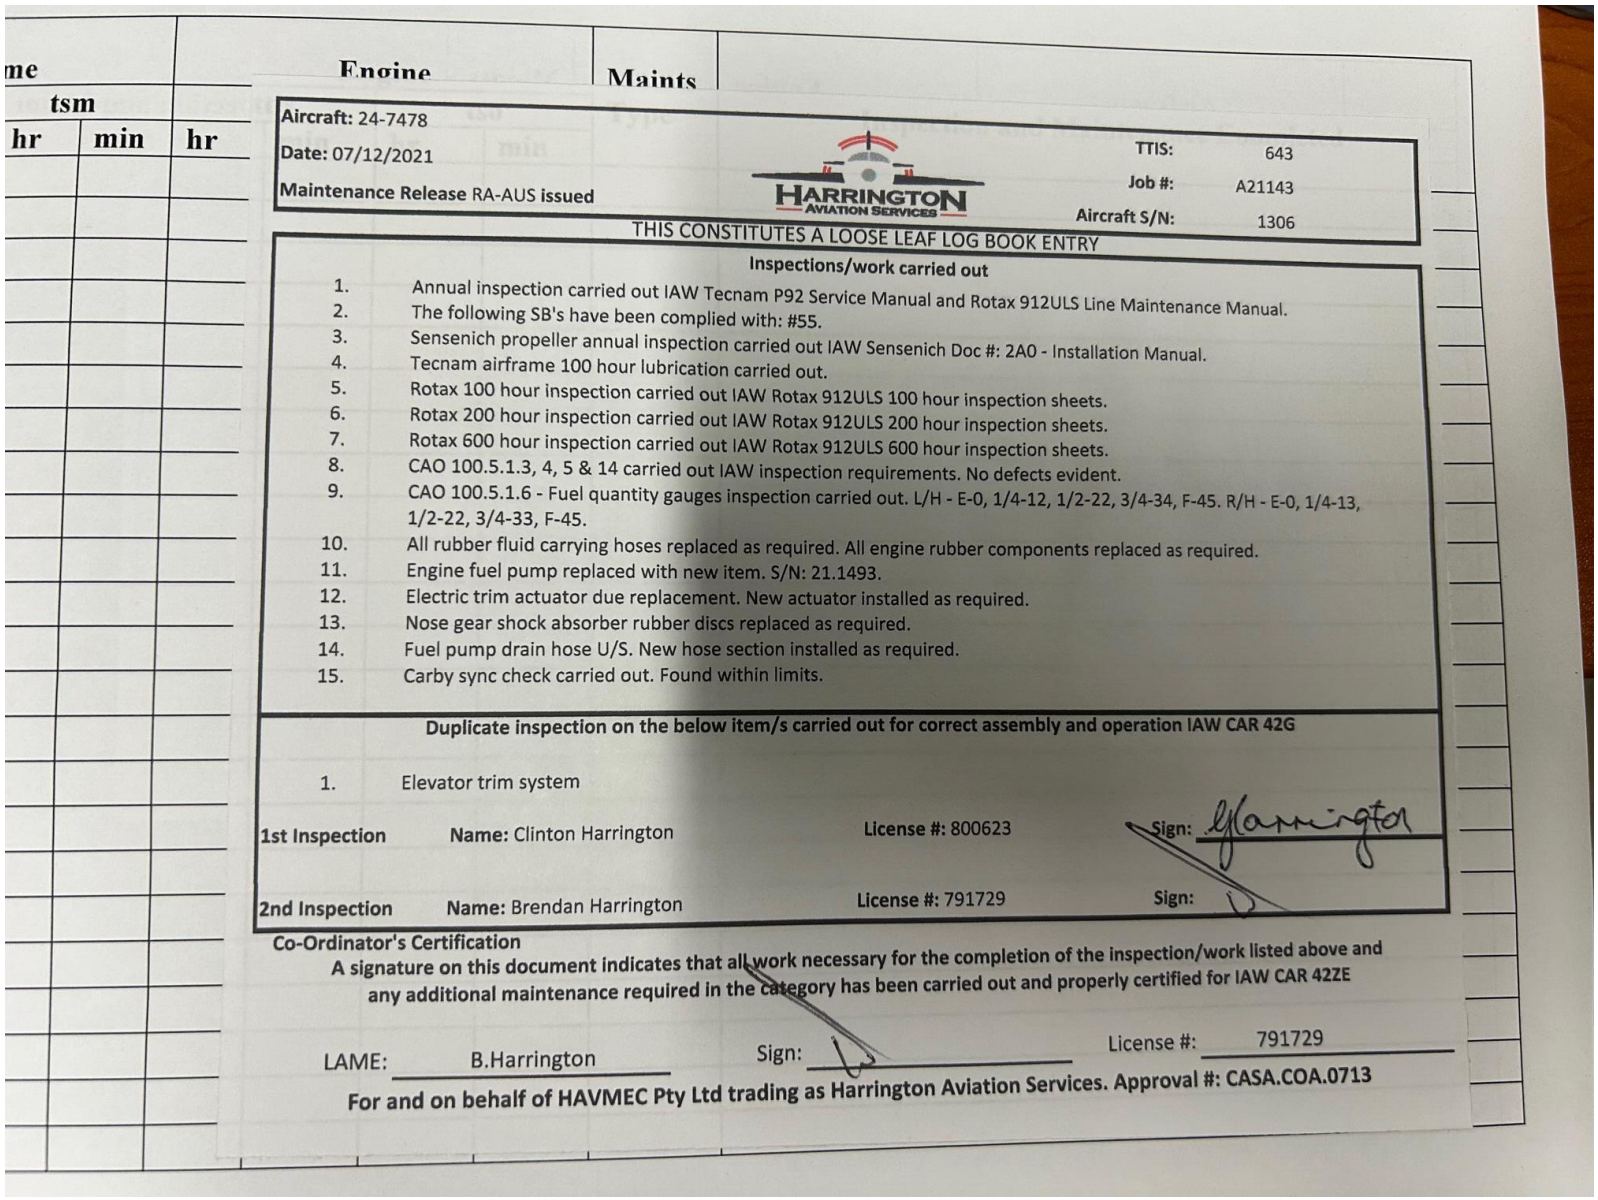

me		Engine	Maints
tsm			
hr	min	hr	

Aircraft: 24-7478
Date: 07/12/2021
Maintenance Release RA-AUS **issued**

HARRINGTON AVIATION SERVICES

TTIS: 643
Job #: A21143
Aircraft S/N: 1306

THIS CONSTITUTES A LOOSE LEAF LOG BOOK ENTRY

Inspections/work carried out

1. Annual inspection carried out IAW Tecnam P92 Service Manual and Rotax 912ULS Line Maintenance Manual.
2. The following SB's have been complied with: #55.
3. Sensenich propeller annual inspection carried out IAW Sensenich Doc #: 2A0 - Installation Manual.
4. Tecnam airframe 100 hour lubrication carried out.
5. Rotax 100 hour inspection carried out IAW Rotax 912ULS 100 hour inspection sheets.
6. Rotax 200 hour inspection carried out IAW Rotax 912ULS 200 hour inspection sheets.
7. Rotax 600 hour inspection carried out IAW Rotax 912ULS 600 hour inspection sheets.
8. CAO 100.5.1.3, 4, 5 & 14 carried out IAW inspection requirements. No defects evident.
9. CAO 100.5.1.6 - Fuel quantity gauges inspection carried out. L/H - E-0, 1/4-12, 1/2-22, 3/4-34, F-45. R/H - E-0, 1/4-13, 1/2-22, 3/4-33, F-45.
10. All rubber fluid carrying hoses replaced as required. All engine rubber components replaced as required.
11. Engine fuel pump replaced with new item. S/N: 21.1493.
12. Electric trim actuator due replacement. New actuator installed as required.
13. Nose gear shock absorber rubber discs replaced as required.
14. Fuel pump drain hose U/S. New hose section installed as required.
15. Carby sync check carried out. Found within limits.

Duplicate inspection on the below item/s carried out for correct assembly and operation IAW CAR 42G

1. Elevator trim system

1st Inspection **Name:** Clinton Harrington **License #:** 800623 **Sign:** CHarrington

2nd Inspection **Name:** Brendan Harrington **License #:** 791729 **Sign:**

Co-Ordinator's Certification

A signature on this document indicates that all work necessary for the completion of the inspection/work listed above and any additional maintenance required in the category has been carried out and properly certified for IAW CAR 42ZE

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

Go to listing: /listings/17756

LIGHT AIRCRAFT SALES

Seller: Nicholas Christie

Log Books: Tecnam P92 Eaglet (24-7478)

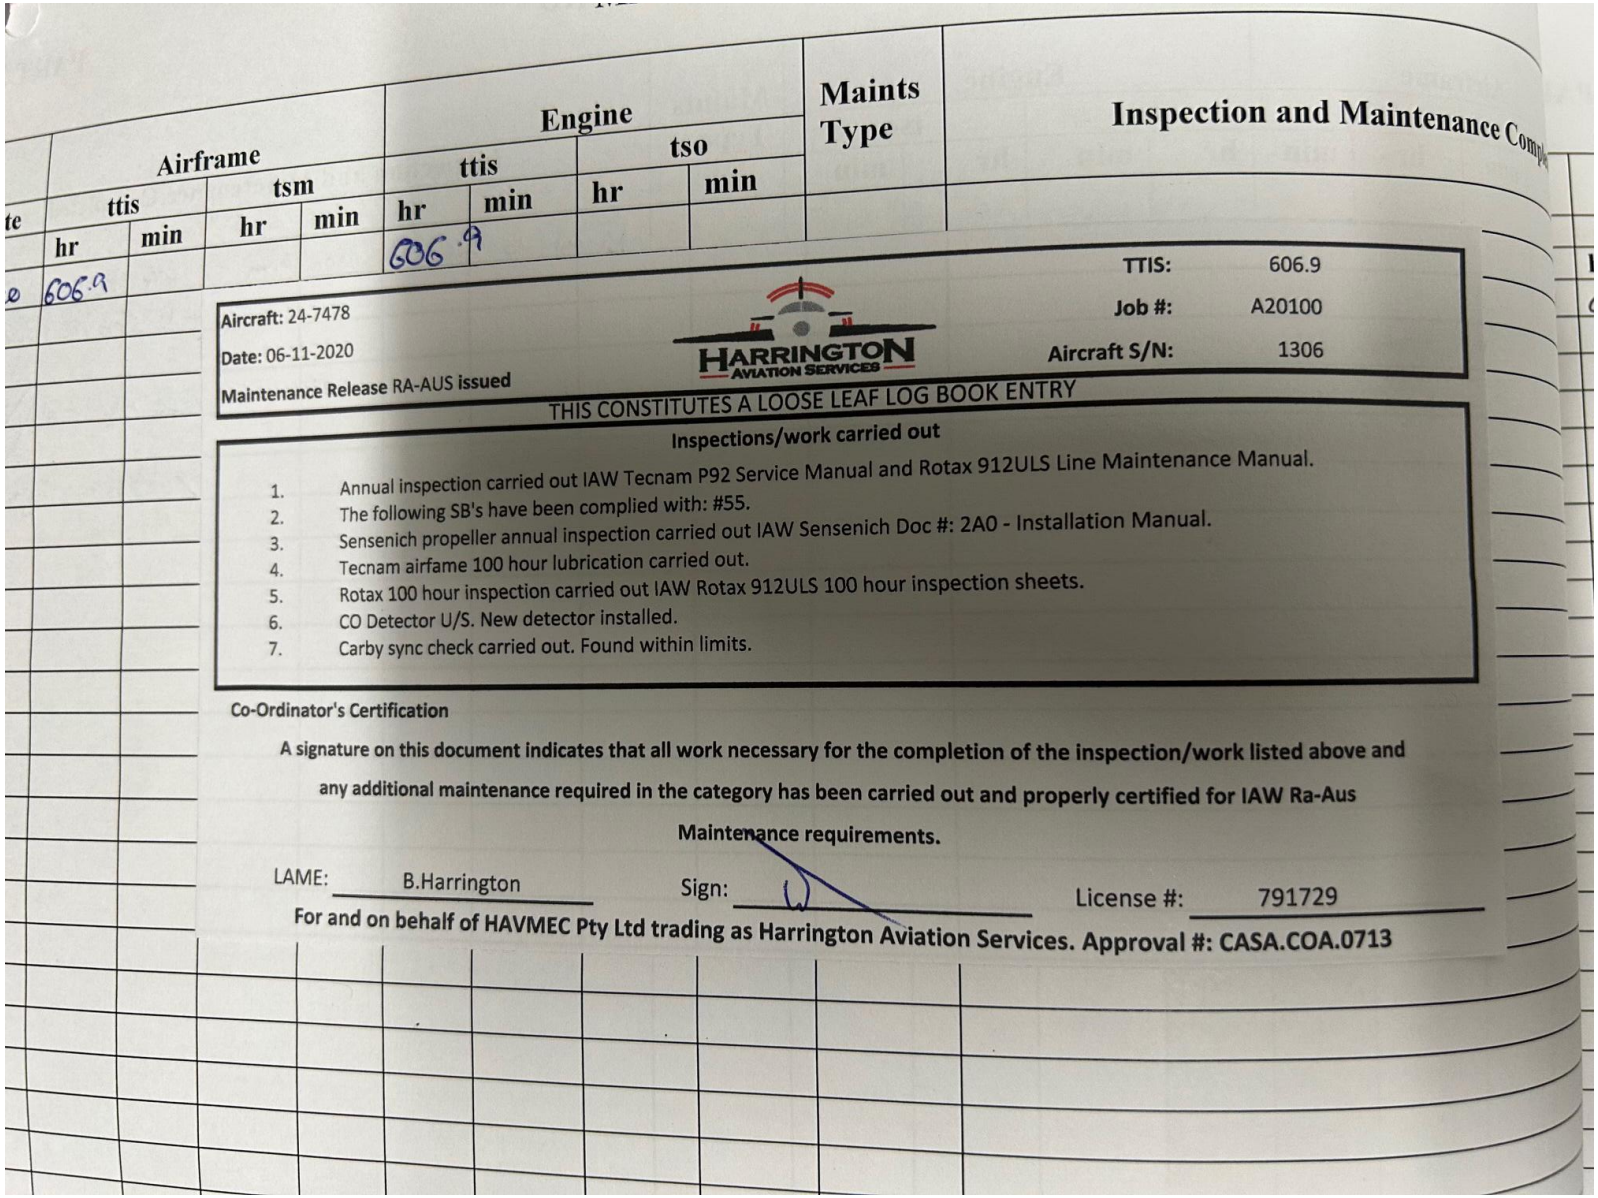

Airframe ttis hr	Airframe ttis min	Airframe tsm hr	Airframe tsm min	Engine ttis hr	Engine ttis min	Engine tso hr	Engine tso min	Maints Type	Inspection and Maintenance Comp
606.9				606.9					

Aircraft: 24-7478

Date: 06-11-2020

Maintenance Release RA-AUS issued

HARRINGTON AVIATION SERVICES

TTIS: 606.9

Job #: A20100

Aircraft S/N: 1306

THIS CONSTITUTES A LOOSE LEAF LOG BOOK ENTRY

Inspections/work carried out

1. Annual inspection carried out IAW Tecnam P92 Service Manual and Rotax 912ULS Line Maintenance Manual.
2. The following SB's have been complied with: #55.
3. Sensenich propeller annual inspection carried out IAW Sensenich Doc #: 2A0 - Installation Manual.
4. Tecnam airfame 100 hour lubrication carried out.
5. Rotax 100 hour inspection carried out IAW Rotax 912ULS 100 hour inspection sheets.
6. CO Detector U/S. New detector installed.
7. Carby sync check carried out. Found within limits.

Co-Ordinator's Certification

A signature on this document indicates that all work necessary for the completion of the inspection/work listed above and any additional maintenance required in the category has been carried out and properly certified for IAW Ra-Aus Maintenance requirements.

LAME: B.Harrington Sign: _____ License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

Go to listing: /listings/17756

LIGHT AIRCRAFT SALES

Seller: Nicholas Christie

Log Books: Tecnam P92 Eaglet (24-7478)

tsm		ttis		tso		Type	Inspection and Maintenance Completed
r	min	hr	min	hr	min		
							adjusted to maintain 1800 RPM at idle settings.
							Engine carby synchronize required. Carried out.
							All work carried out by HAVMEC Pty Ltd. T/A
							Harrington Aviation Services.
							Co-ord: B. Harrington Lic # 791729/028967 Sign:
		556.2					

Aircraft: 24-7478 **TTIS:** 556.2

Date: 08-11-2019 **Job #:** A19100

Maintenance Release RA-AUS **issued** **Aircraft S/N:** 1306

HARRINGTON AVIATION SERVICES

THIS CONSTITUTES A LOOSE LEAF LOG BOOK ENTRY

Inspections/work carried out

1. Annual inspection carried out IAW Tecnam P92 Service Manual and Rotax 912ULS Line Maintenance Manual.
2. The following SB's have been complied with: #55.
3. Sensenich propeller annual inspection carried out IAW Sensenich Doc #: 2A0 - Installation Manual.
4. Pilot reported static during radio transmissions. Radio found U/S. New Icom A220 installed.
5. Engine oil leaking from inline thermostat. All oil line clamps found loose. All clamps re-torqued.
6. Owner requested propeller pitch to be set more fine. Current angle: 23.5 measured 12" from blade tip. Blade angle adjusted to 22. Ground runs carried out. No defects. Engine ground MAX static RPM: 5150.
7. Cabin heat scat hose U/S. New scat hose installed.

Co-Ordinator's Certification

A signature on this document indicates that all work necessary for the completion of the inspection/work listed above and any additional maintenance required in the category has been carried out and properly certified for IAW Ra-Aus Maintenance requirements.

LAME: B.Harrington Sign: License #: 791729

For and on behalf of HAVMEC Pty Ltd trading as Harrington Aviation Services. Approval #: CASA.COA.0713

Go to listing: /listings/17756

LIGHT AIRCRAFT SALES